



GRINDING ISOLATED TRANSVERSE JOINTS

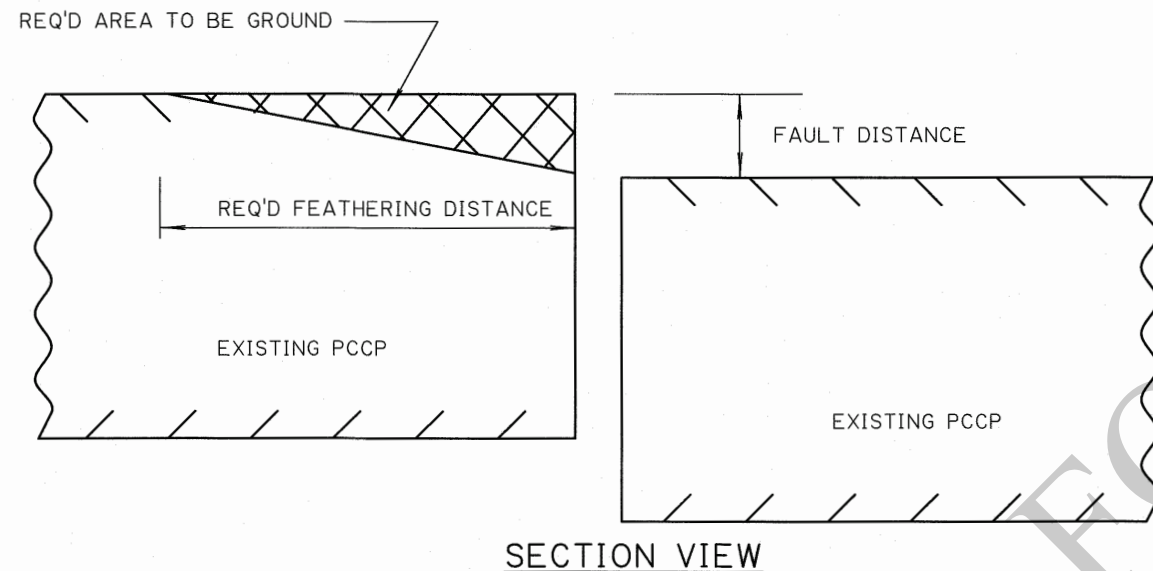

FAULT DISTANCE	FEATHERING DISTANCE
1/4"	5'
3/8"	7.5'
1/2"	10'


- NOTES:
1. IF FAULT IS OVER 1/2", REMOVE AND REPLACE THE FAULTED AREA WITH A FULL DEPTH PATCH.
 2. ALL GRINDING TO BE DONE PRIOR TO JOINT SEALING.
 3. ALL WORK ON THIS DETAIL TO BE PAID FOR UNDER ITEM: MILLING CONCRETE PAVEMENT.
 4. DETAIL NOT TO SCALE.

PAVEMENT GROOVING

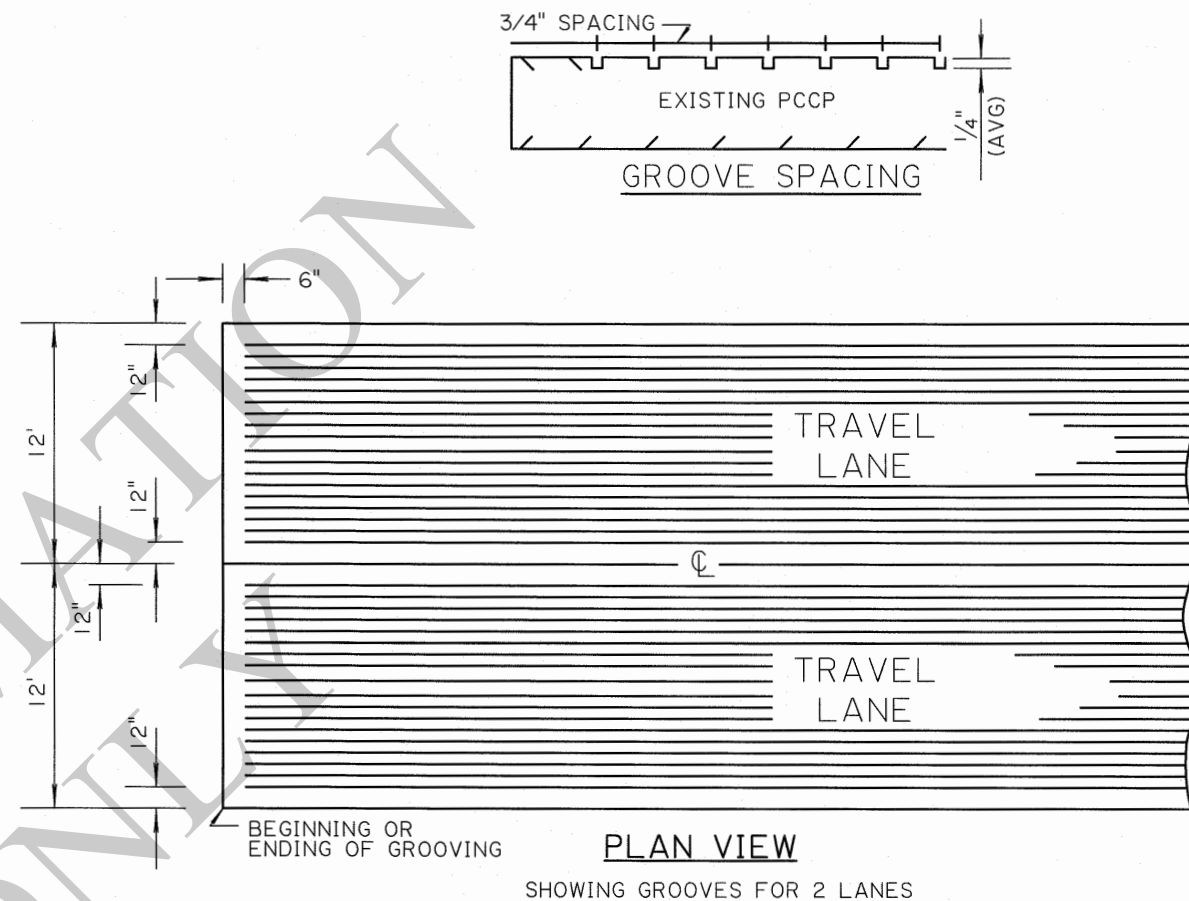

- NOTES:
1. ALL WORK ON THIS DETAIL SHALL BE PAID FOR UNDER ITEM: DIAMOND GROOVING CONCRETE PAVEMENT.
 2. DETAIL NOT TO SCALE.

SHEET NUMBER		PARISH		CONTROL SECTION		STATE PROJECT	
DESIGN	CHECK	B. MAY	J. LACOMBE	DETAIL	CHECK	REVIEW	SERIES # 1 OF 1

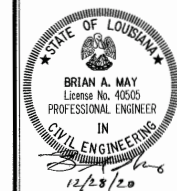

APPROVED BY CHIEF ENGINEER: *[Signature]* DATE: 1/12/2021



CONCRETE REHAB DETAILS

CPR-03



ROAD DESIGN