



GRINDING ISOLATED TRANSVERSE JOINTS



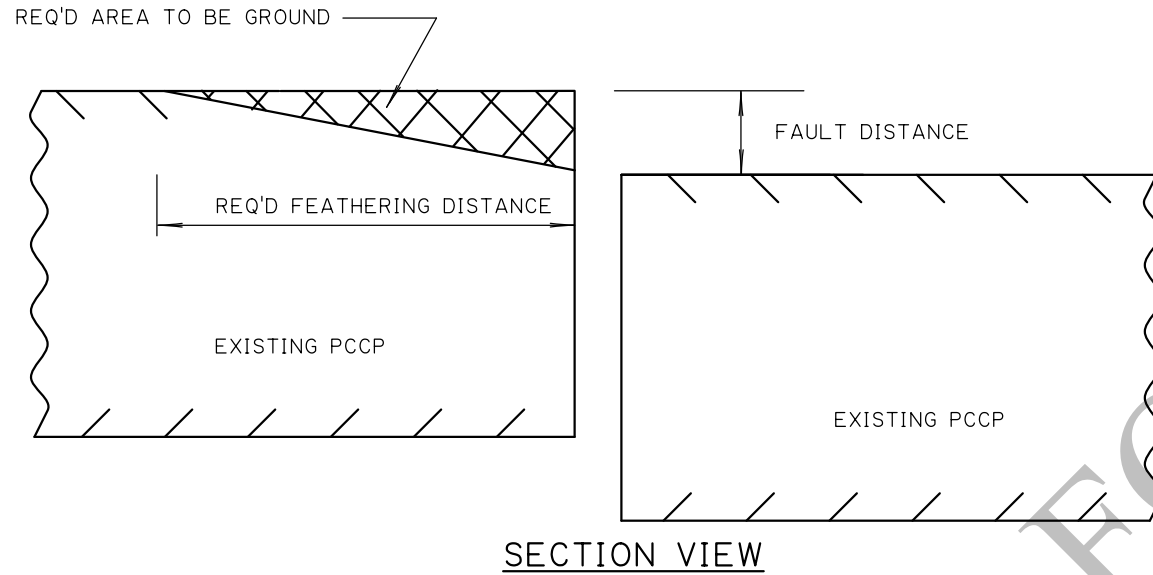

FAULT DISTANCE	FEATHERING DISTANCE
1/4"	5'
3/8"	7.5'
1/2"	10'

- NOTES:
1. IF FAULT IS OVER 1/2", REMOVE AND REPLACE THE FAULTED AREA WITH A FULL DEPTH PATCH.
 2. ALL GRINDING TO BE DONE PRIOR TO JOINT SEALING.
 3. ALL WORK ON THIS DETAIL TO BE PAID FOR UNDER ITEM: DIAMOND GRINDING CONCRETE PAVEMENT.
 4. DETAIL NOT TO SCALE.

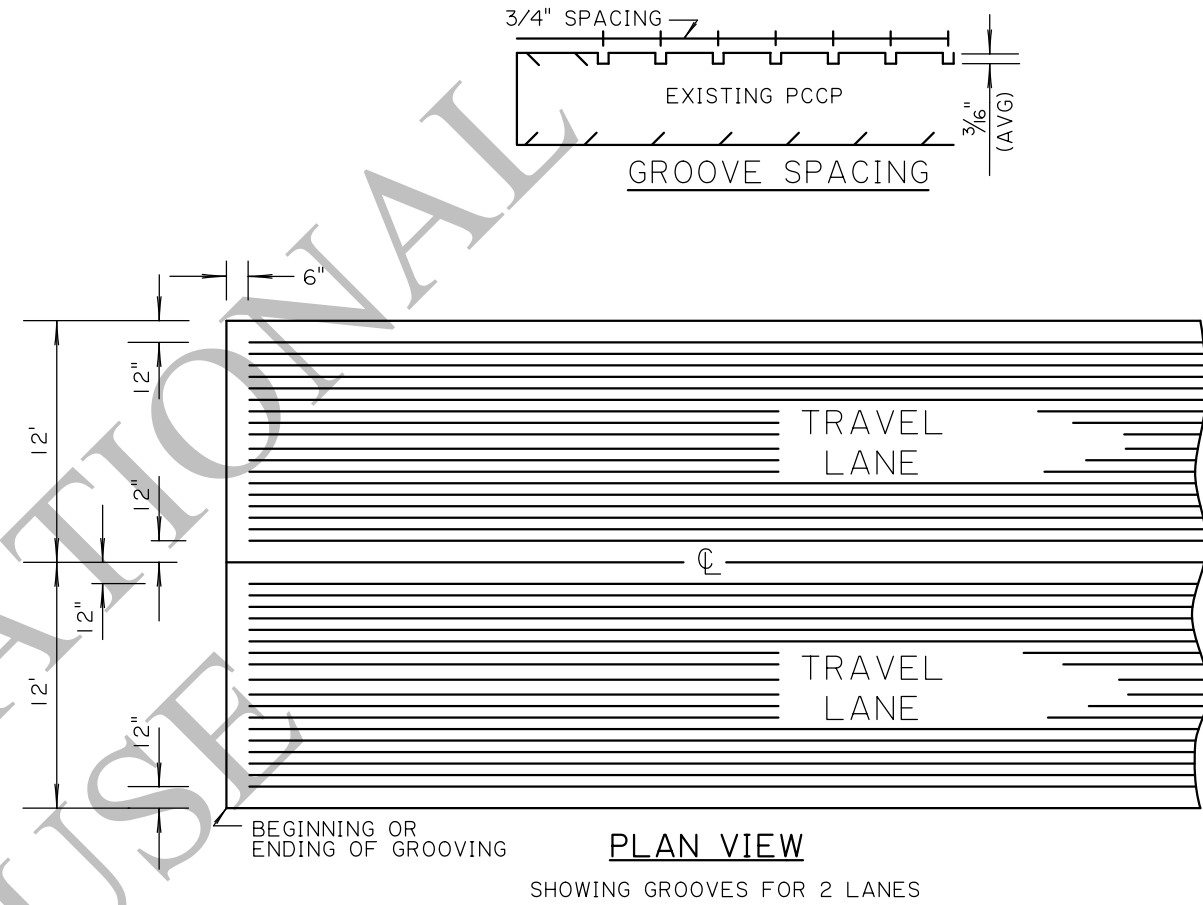PAVEMENT GROOVING



- NOTES:
1. ALL WORK ON THIS DETAIL SHALL BE PAID FOR UNDER ITEM: DIAMOND GROOVING CONCRETE PAVEMENT.
 2. DETAIL NOT TO SCALE.

SHEET NUMBER		PARISH		STATE PROJECT	
DESIGN CHECK	B. MAY R. ISEMANN	DETAIL CHECK	A. BADAWI B. MAY	REVIEW	SERIES # 1 OF 1
APPROVED BY CHIEF ENGINEER:			DATE: 4/6/2026		
					
CONCRETE REHAB DETAILS					
CPR-03					
					
STANDARD PLAN					