




## GRINDING ISOLATED TRANSVERSE JOINTS

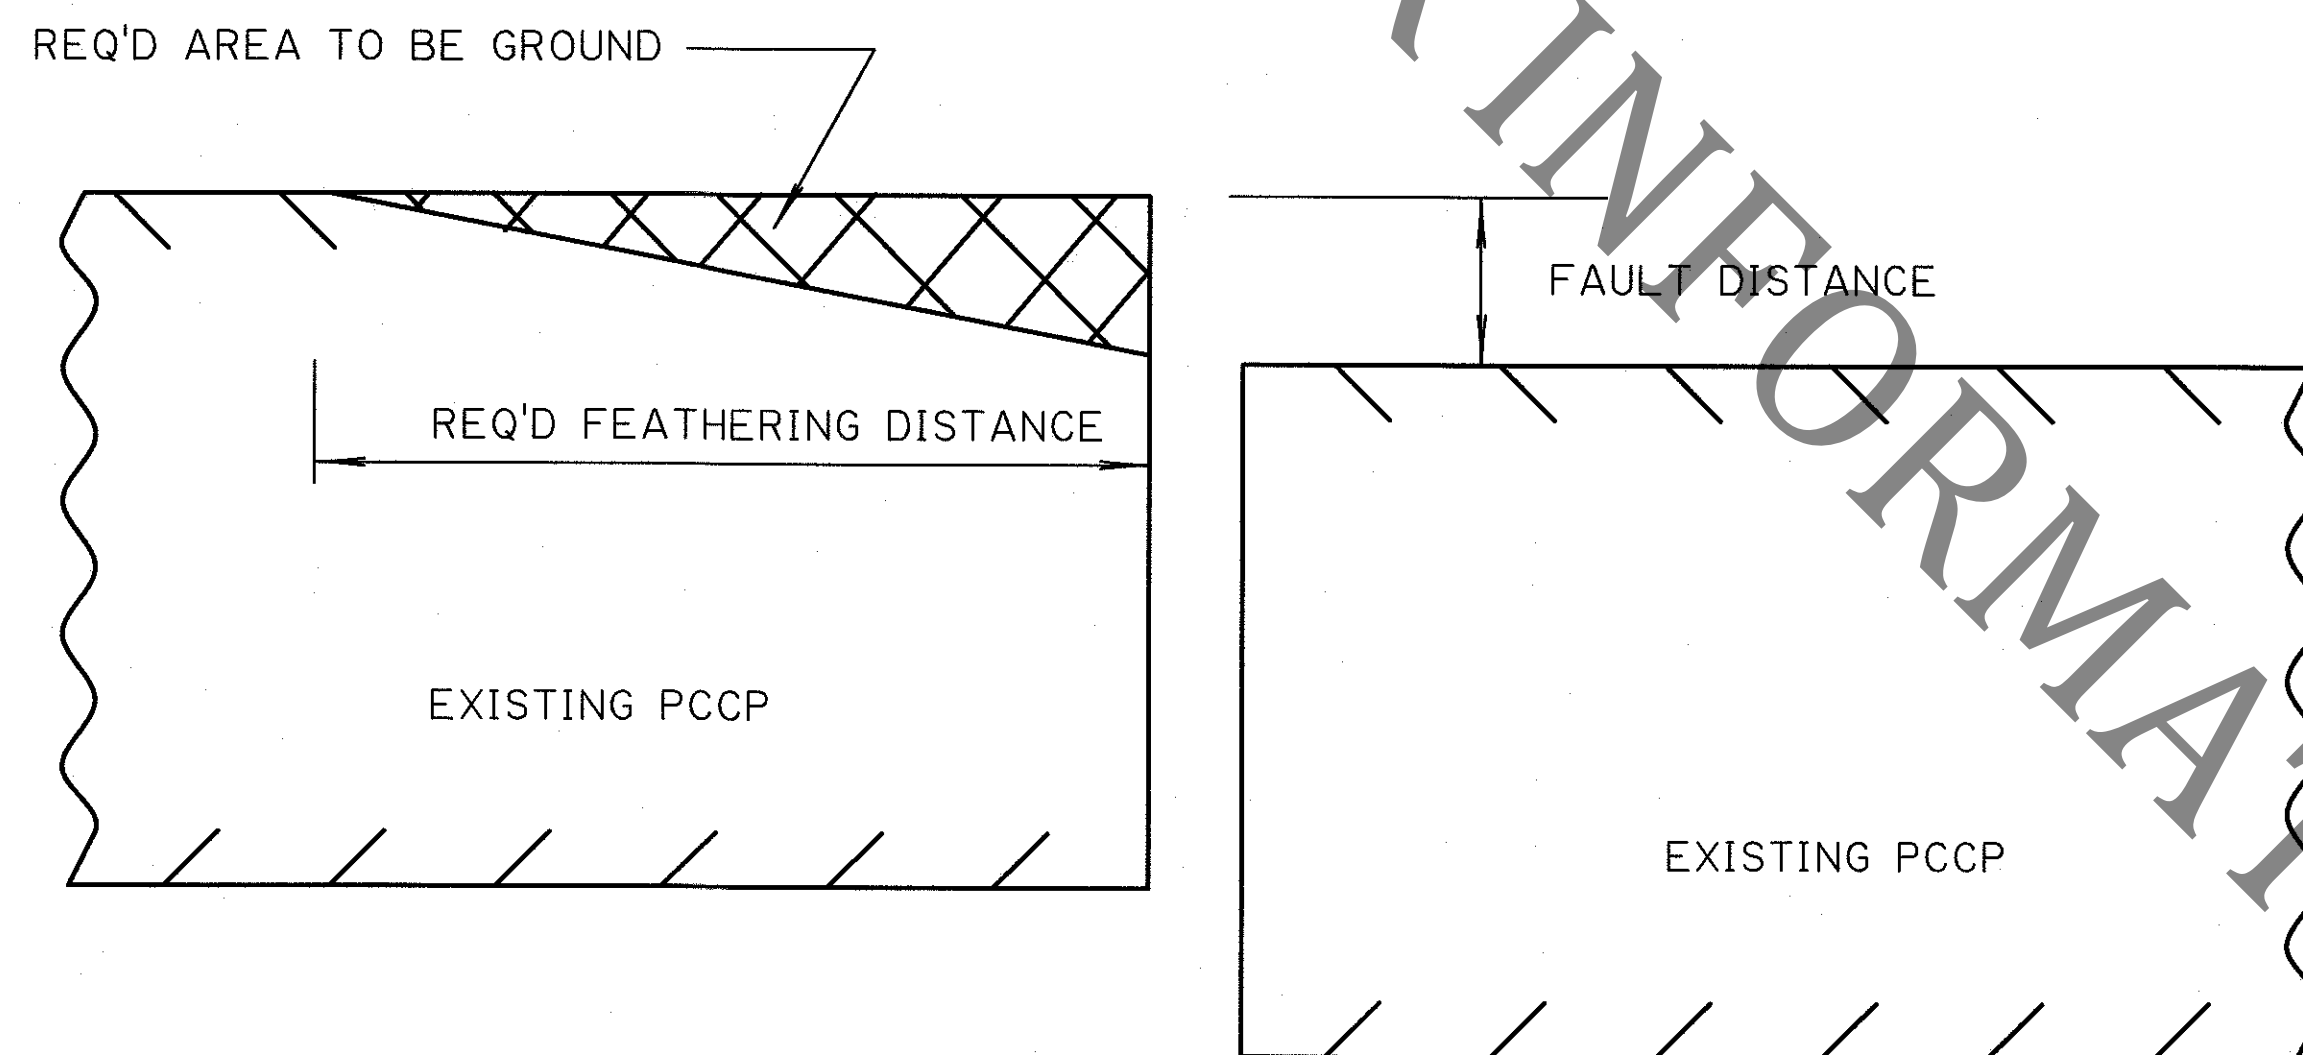

SECTION VIEW

FAULT DISTANCE	FEATHERING DISTANCE
1/4"	5'
3/8"	7.5'
1/2"	10'

## PAVEMENT GROOVING

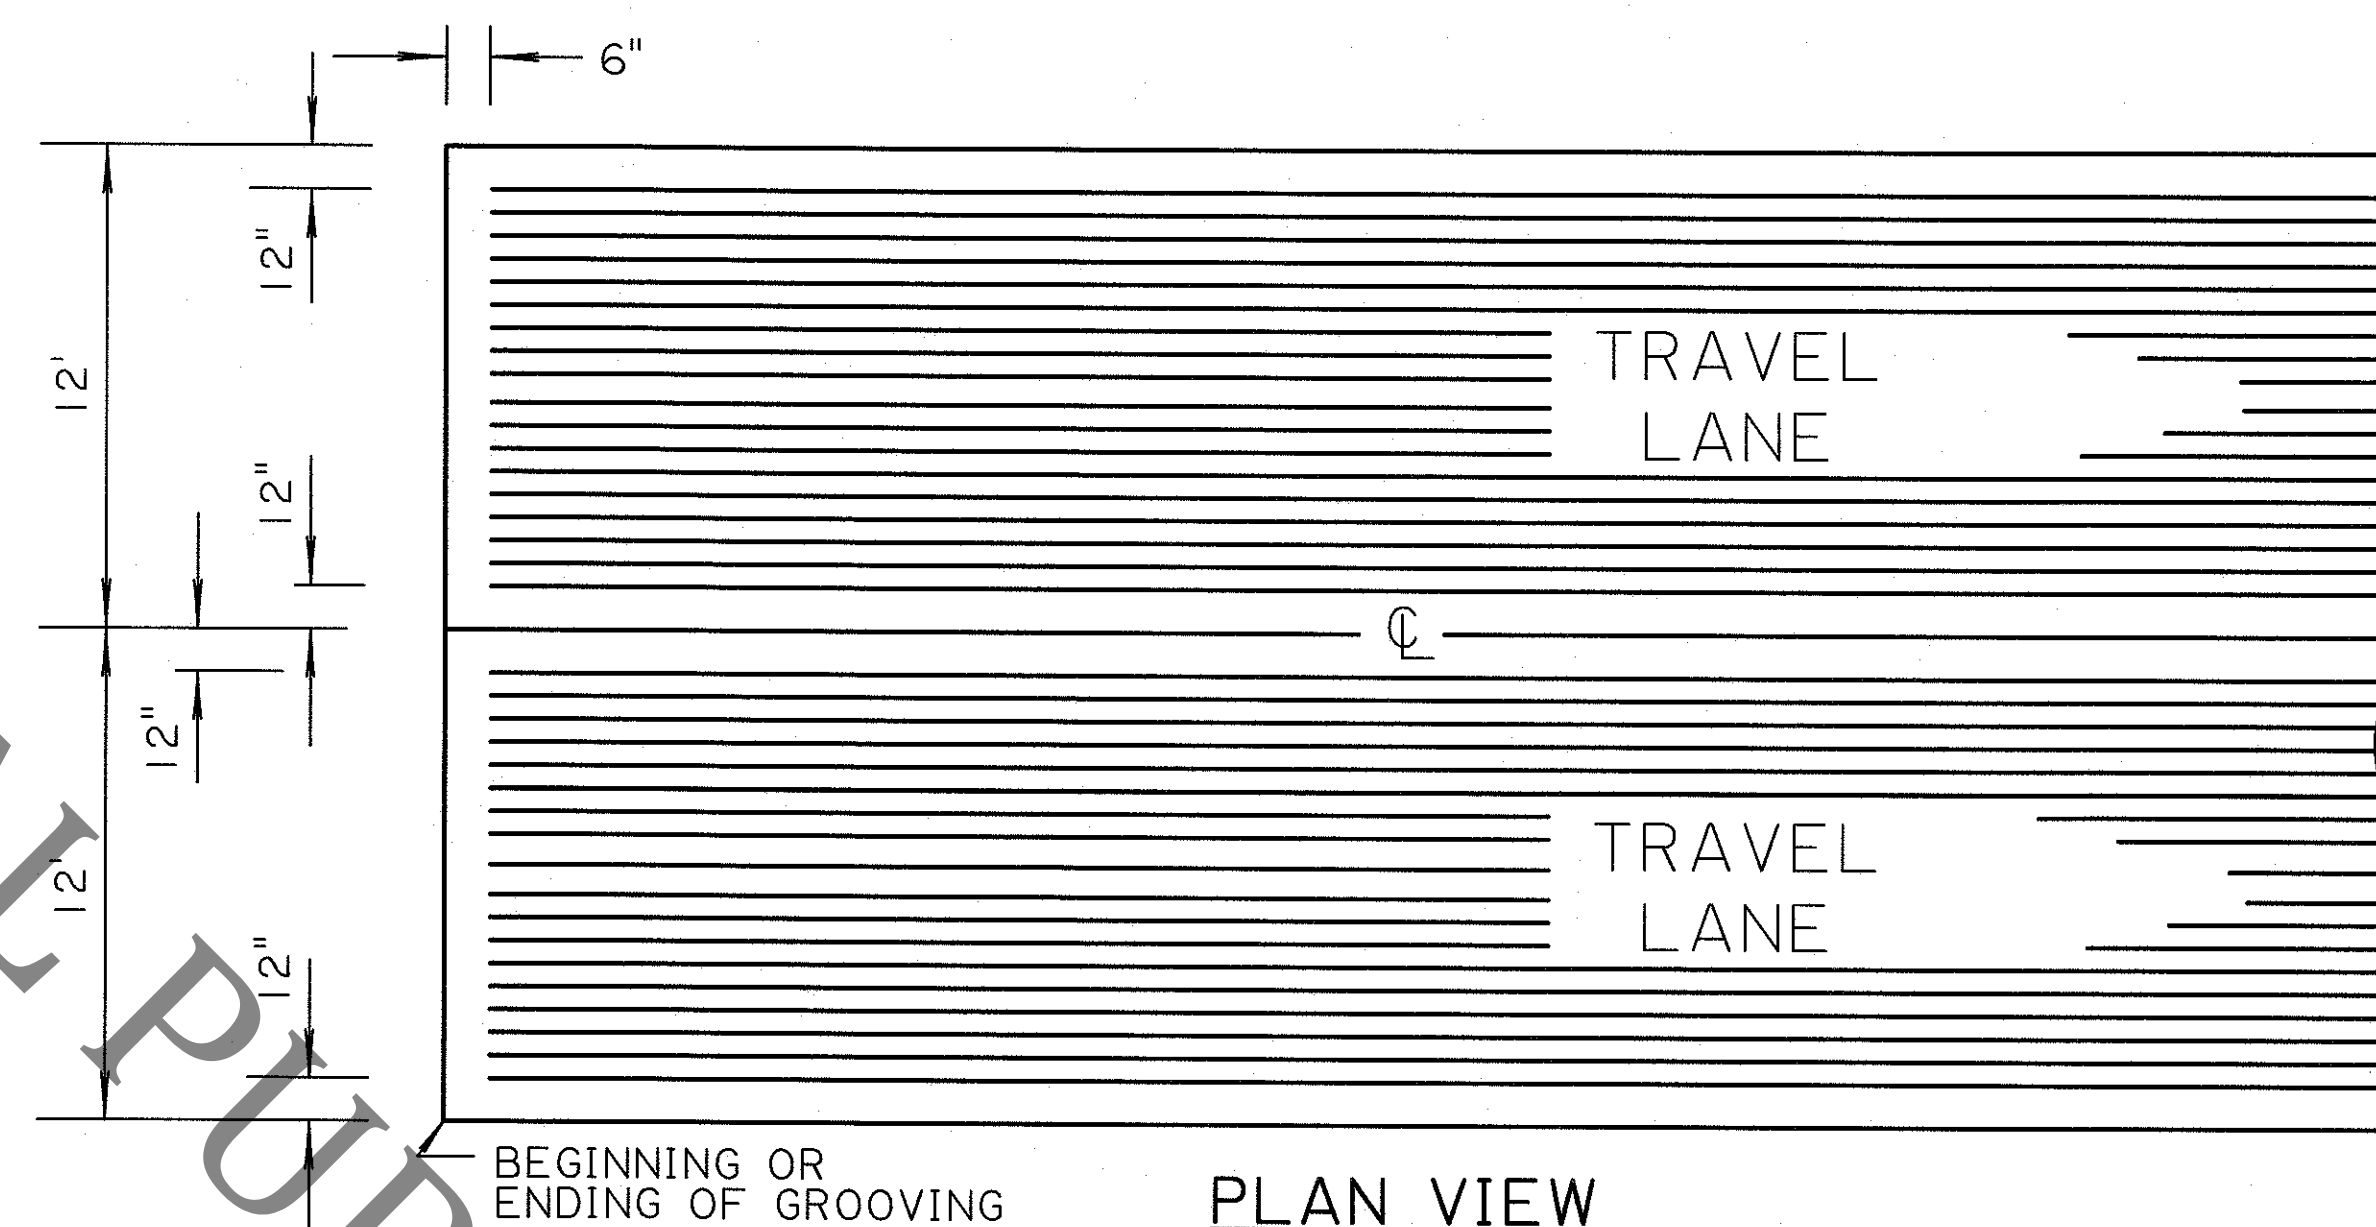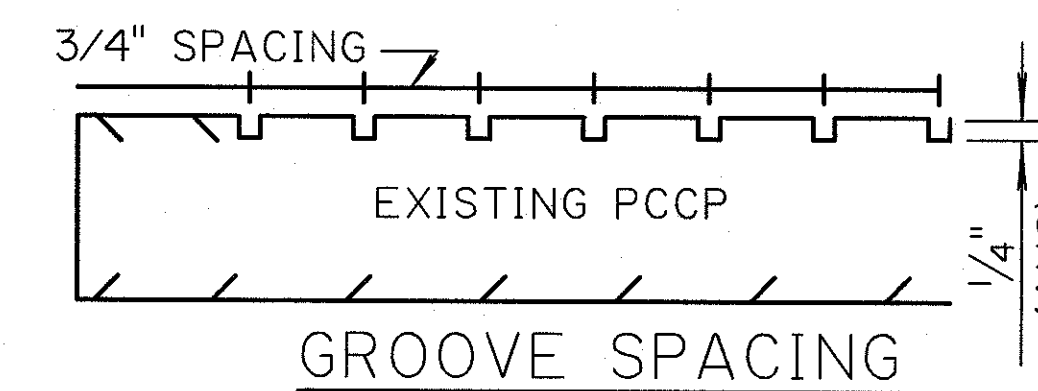

PLAN VIEW


SHOWING GROOVES FOR 2 LANES

NOTES:

- NOTES:
1. IF FAULT IS OVER  $\frac{1}{2}$ ", REMOVE AND REPLACE THE FAULTED AREA WITH A FULL DEPTH PATCH.
  2. ALL GRINDING TO BE DONE PRIOR TO JOINT SEALING.
  3. ALL WORK ON THIS DETAIL TO BE PAID FOR UNDER ITEM: MILLING CONCRETE PAVEMENT.
  4. DETAIL NOT TO SCALE.

NOTES:

1. ALL WORK ON THIS DETAIL SHALL BE PAID FOR UNDER ITEM:  
DIAMOND GROOVING CONCRETE PAVEMENT.
2. DETAIL NOT TO SCALE.

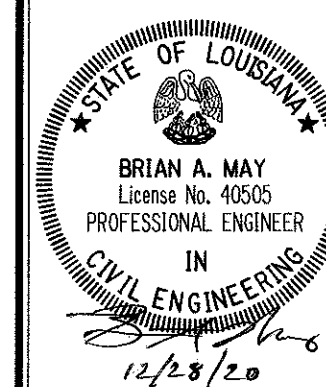

APPROVED BY CHIEF ENGINEER:

*Ch. B. P. King*

DATE: 1/12/2021



## CONCRETE REHAB DETAILS

CPR-03



ROAD DESIGN